

# **Technical Bulletin**

**BULLETIN NO. 0-8.25.2011** 

**DATE:** August 25, 2011

**TO:** All OLSEN Boiler Customers

FROM: ECR International, Inc. Technical Service Department

TITLE: OMGB Heat Exchanger Revision



#### **MODELS AFFECTED**

			Effective Date:
OMGB 50-300	Nat & LP Gas	Spark and Std Pilot	September, 2011

### **SITUATION:**

The current heat exchanger used on the OMGB series OLSEN Boiler has replaced with a new style casting of advanced design.

The flowing changes to the OMGB series have been incorporated into all new equipment effective manufacturing date September, 2011. The model description of the OMGB series in the future will be as described in example OMGB-100JID (spark) or OMGB-100JD (standing pilot)

If you should have any questions at all on these changes to the product or on a replacement block assembly, please feel free to contact Morden National Sales and Marketing Inc. in Canada at 1.888.270.8324 or ECR Technical Service Department at 1.800.325.5479 Extension # 7022.





### OMGB Heat Exchanger Revision BULLETIN NO. O- 8.25.2011

Incorporated changes to the **OMGB** series includes the following:

Input (Mbh)	50	75	100	125	150	175	200	250	300
Sections	2	3		4		5		6	7
Label				✓	✓	✓	<b>✓</b>	✓	✓
Replace Base & Rollout Switch				✓	<b>√</b>				
Replace Rollout Switch Bracket On Base Panel						<b>√</b>	<b>√</b>	<b>✓</b>	<b>✓</b>
Draft Diverter w/ New Blocked Vent Safety Switch Bracket								<b>✓</b>	
Replace Burner Door, Lower Access Panel Door, & Spark Pilot Shield				<b>√</b>	<b>√</b>	<b>√</b>	<b>√</b>	<b>√</b>	<b>✓</b>

Figure 1 - Replacement Burner Door with Tabs

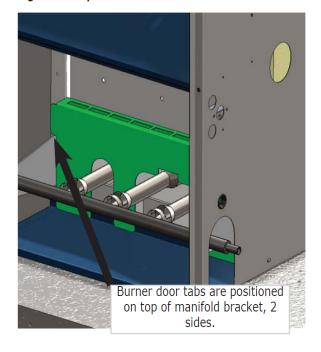

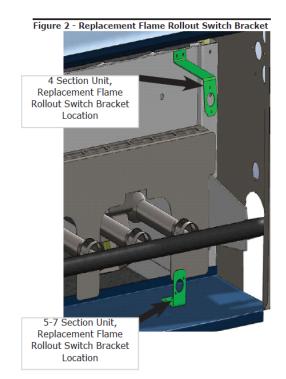



## OMGB Heat Exchanger Revision BULLETIN NO. O- 8.25.2011

Figure 3 - Pilot Shield Bracket


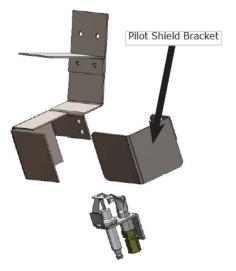


Figure 4 - Pilot Shield Location

Pilot Shield attached to Pilot Bracket



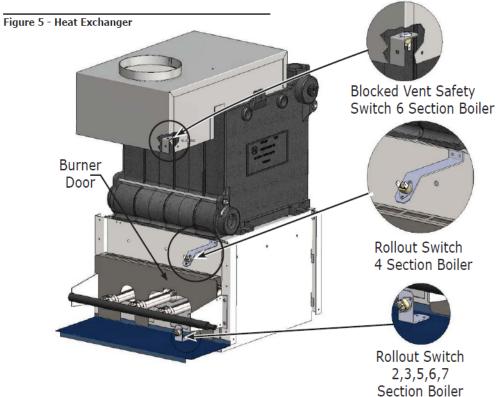

OMGB Heat Exchanger Revision BULLETIN NO. O- 8.25.2011



#### Replacement Heat Exchangers On Older Products

The new heat exchanger has been engineered to be replaceable into any of the older series OMGB models with the following field update kits. These kits will be shipped with a replacement block when ordered as future replacements.

Boiler	OMGB-50	OMGB-75	OMGB-125	OMGB-175	OMGB-250	OMGB-300
Model		OMGB-100	OMGB-150	OMGB-200		
Sections	2	3	4	5	6	7
Replacement						
Number	912000001	912000002	550002349	550002350	550002351	550002352

If you should have any questions at all on these changes to the product or on a replacement block assembly, please feel free to contact Morden National Sales and Marketing Inc. in Canada at 1.888.270.8324 or ECR Technical Service Department at 1.800.325.5479 Extension # 7022.